

Manhole Inspection Summary

Manhole # S09C__019MH

Printed On: 6/24/2010

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **2) Good**

Record Plat: **09C** Node: **019** Status: **Found**

Insp Date: **2/2/09 10:11 AM**

Incomplete Comments

Crew: **SD WJ**
Inspector: **Chung**
Firm: **URS**

Location Address: **621 DENISON ST**

Cross Street: **HARLEM AVE**

Manhole Type: **Terminal** Location: **Alley**

Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry**

Subject To Ponding: **None**

Comments **HEAVY DEBRIS IN CHANNEL**

Cover Shape: **Circular** Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **2** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☐ Exists Material: ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Partially Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**


Steps Count: **2** Missing: **0** ☐ Corroded

Surcharge ☒ **Evidence Of Surcharge** Depth: **1** (ft.) ☐ Active Surcharge Present

Location View



Top View

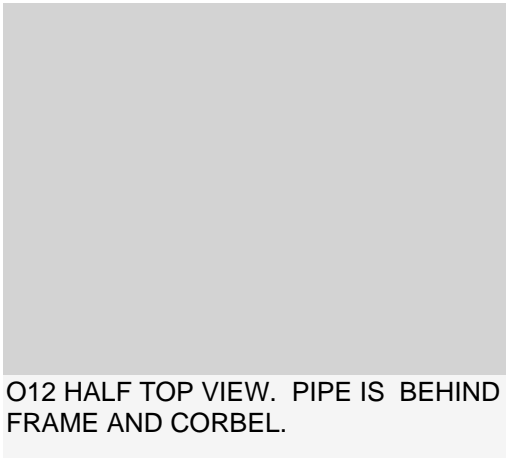

Top View



OFFSET



Manhole Inspection Summary

Manhole # S09C__019MH

Printed On: 6/24/2010

Page 3 of 3

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



EVIDENCE OF SURCHARGE AT O12 PIPE

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **5.10** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☒ **Slurry** ☐ Debris ☐ Grease

Silt Depth: **1** (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection